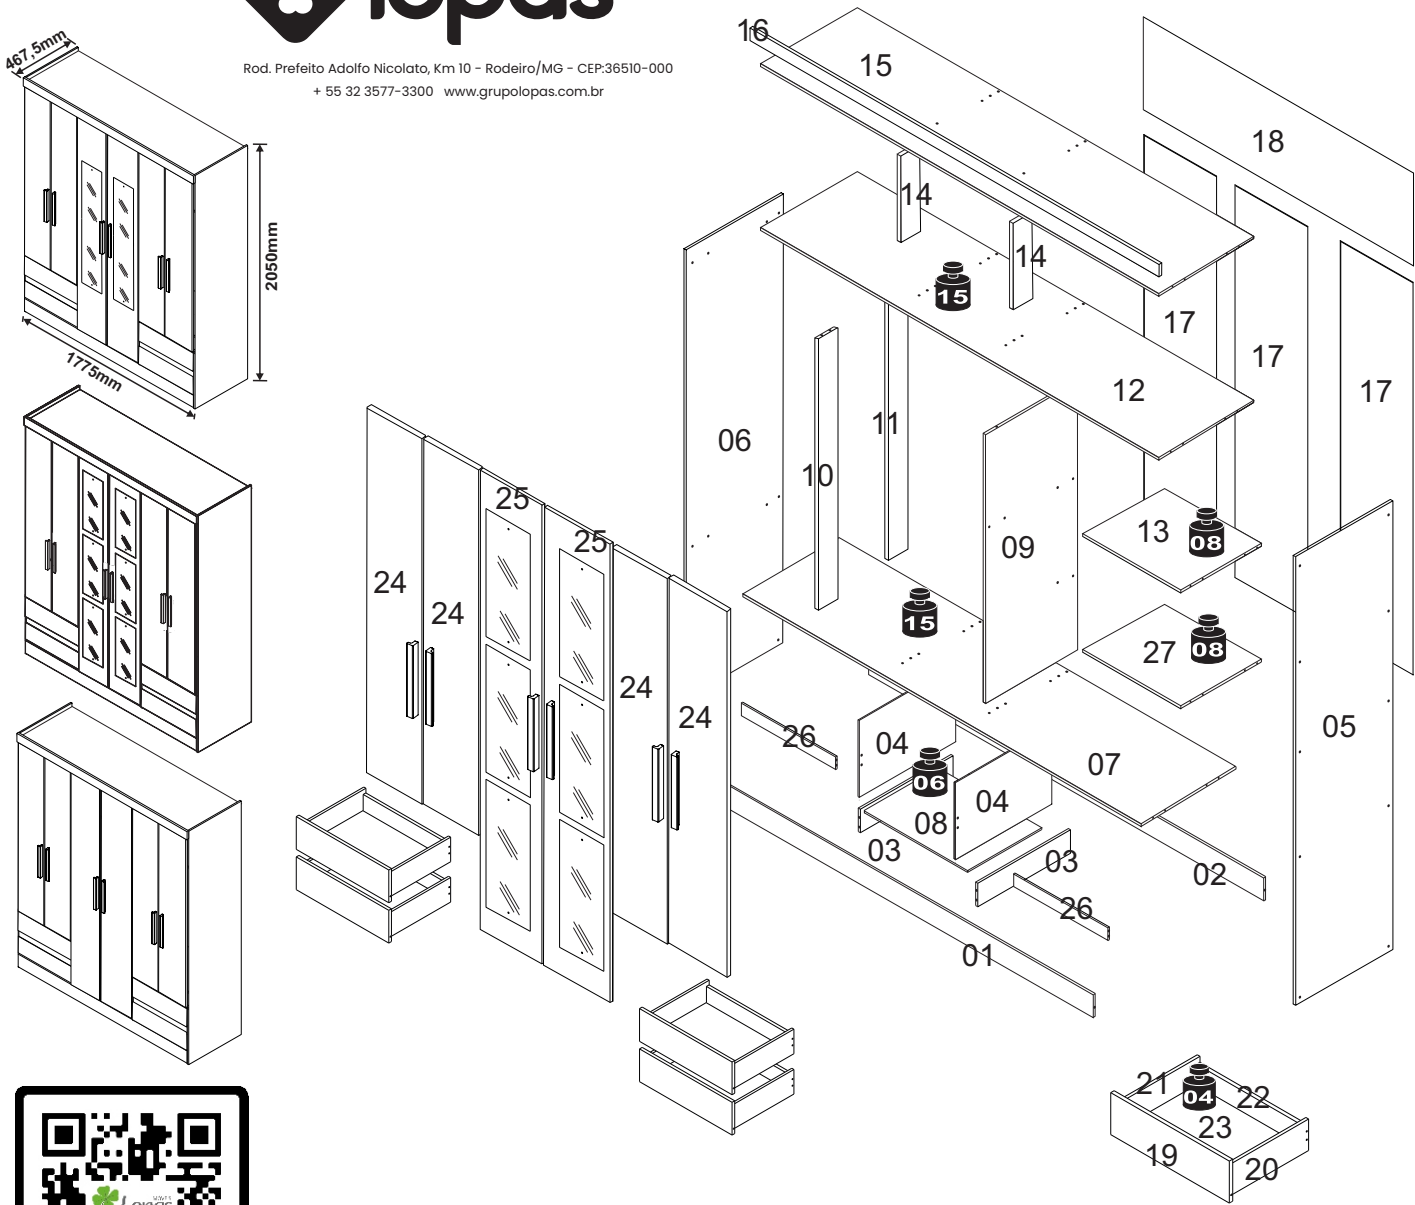






Rod. Prefeito Adolfo Nicolato, Km 10 - Rodeiro/MG - CEP:36510-000
+ 55 32 3577-3300 www.grupolopas.com.br







Instruções de montagem Roupeiro Zeus 6pts Plus/Zeus 2021
Assembly instructions Zeus 6pts Plus Wardrobe
Intrucciones de armado Ropero Zeus 6pts Plus

 **Peso máximo suportado**
Maximum weight supported
Peso máximo suportado

N°	CÓDIGO CODE CODIGO	DESCRIÇÃO DESCRIPTION DESCRIPCIÓN	DIMENSÃO (mm) DIMENSION (mm) DIMENSIÓN (mm)			QUANTIDADE QUANTITY CANTIDAD
			COMP. LON. LEN.	LARG. WID. ANC.	ALT. DEP. ESP.	
1	130	RODAPE FRONTAL GR 6 PTS ZEUS MDP	1750	90	12	1
2	131	RODAPE TRASEIRO GR 6 PTS ZEUS MDP	1750	90	12	1
3	135	PINAZIO GR ZEUS/JAZZ/CEL/BAR/EASY/AN SOFT MDP	425	90	12	2
4	105	DIVISAO GAVETA GR 4/6 PTS ZEUS PLUS MDP	449	362	12	2
5	140	LATERAL DIREITA GR 4/6 PTS ZEUS PLUS MDP	2050	450	12	1
6	141	LATERAL ESQUERDA GR 4/6 PTS ZEUS PLUS MDP	2050	450	12	1
7	122	TAMPO INFERIOR GR 6 PTS ZEUS MDP	1750	450	12	1
8	145	FUNDO GR 4/6/8 PTS ZEUS/VIRGO/EASY/ANDARA SOFT HDF	575	450	4	1
9	143	DIVISAO GR 6 PTS ZEUS MDP	1137	449	12	1
10	124	BATENTE FRONTAL C/MARCACAO GR 6 PTS ZEUS MDP	1137	80	12	1
11	125	BATENTE TRASEIRO GR 6 PTS ZEUS/VIRGO/BARDO MDP	1137	80	12	1
12	121	TAMPO CENTRAL GR 6 PTS ZEUS MDP	1750	450	12	1
13	104	PRATELEIRA GR 4/6 PTS ZEUS/VIRGO/EASY P2L MDP	575	330	12	1
14	149	DIVISAO MALEIRO GR 4/6 PTS F/T ZEUS/FRON LAN/ZEI/BAR MDP	350	80	12	2
15	138	TAMPO SUPERIOR GR 6 PTS ZEUS MDP	1750	450	12	1
16	110	MOLDURA GR 6 PTS ZEUS/EASY MDP	1770	80	15	1
17	148	COSTAS GR 3/4/6 PTS ZEUS/VIRGO HDF	1530	588	2,7	3
18	147	COSTAS MALEIRO GR 6 PTS ZEUS 2023 HDF	1765	365	2,7	1
19	112	FRENTE GAVETA GR 4/6 PTS ZEUS PLUS MDP	582	160	15	4
20	127	LATERAL GAVETA DIREITA GR JA/ZE/ANN/BAR/SAI/EA/AND SO MDP	350	120	12	4
21	128	LATERAL GAVETA ESQUERDA GR JA/ZE/ANN/BAR/SAI/EA/AND MDP	350	120	12	4
22	118	TRASEIRO GAVETA GR 4/6 PTS ZEUS PLUS MDP	526	80	12	4
23	146	FUNDO GAVETA GR 4/6 PTS ZEUS PLUS HDF	538	357	2,7	4
24	108	PORTA PEQUENA GR 4/6 PTS ZEUS PLUS MDP	1505	290	15	4
25	106	PORTA GRANDE GR 4/6/8 PTS ZEUS/VIRGO/EASY SLIM MDP	1877	290	15	2
26	115	VISTA GAVETA GR 4/6 PTS ZEUS PLUS MDP	575	60	12	2
27	103	PRATELEIRA INFERIOR GR 4/6 PTS ZEUS MDP	575	330	12	1

W1- ESPELHO OPCIONAL OPTIONAL MIRROR ESPEJO OPCIONAL	x06
 500x200x3	CÓD. 79838
W2 - ESPELHO OPCIONAL OPTIONAL MIRROR ESPEJO OPCIONAL	x02
 900x235x03	CÓD.73423
X - PÉ OPCIONAL 70MM 70MM OPTIONAL FOOT PIÉ OPCIONAL 70MM	x08
	BRANCO CÓD. 2351 FRASSINO CÓD. 72570 AMENDOA CÓD. 72561
Y - PARAFUSO 3,5X14MM 3,5X14MM SCREW TORNILLO 3,5X14MM	x32
	CÓD. 86474
AA - TAPA FURO ADESIVO ADHESIVE SCREW COVER TAPA TORNILLO ADESIVO	x16
	FRASSINO CÓD. 78600 BRANCO CÓD. 78392 AMENDOA CÓD. 78595

A - DOBRADIÇA 26MM 26MM FRAME WING BISAGRA 26MM	x18
	CÓD. 78144
B - CALÇO DOBRADIÇA 26MM 26MM DOOR WING SOPORTE BISAGRA 26MM	x18
	CÓD. 77517
C - PUXADOR DE MADEIRA WOODEN HANDLE TIRADOR DE MADERA	x06
	BRANCO CÓD. 86463 AMENDOA CÓD. 86455 FRASSINO CÓD. 86469
D - SUPORTE CABIDEIRO COAT HANGER SUPPORT SOPORTE PARA PERCHERO	x02
	45X24X19MM CÓD. 75785
E - SAPATA L 15 MM L BRACKET 15 MM BASE DE LA PATA L 15 MM	x08
	CÓD. 75758
F - PARAFUSO 3,5X40MM FLANGEADO 3,5X40MM WASHER HEAD SCREW TORNILLO 3,5X40MM FLANGEADO	x16
	CÓD. 75661
G - CAVILHA MADEIRA 6X30MM 6X30MM WOODEN DOWEL TARUGO DE MADERA 6X30MM	x72
	CÓD. 73295
H - PARAFUSO 3,5X12MM 3,5X12MM SCREW TORNILLO 3,5X12MM	x116
	CÓD. 73559
I - PARAFUSO 3,5X30MM PRETO 3,5X30MM BLACK SCREW TORNILLO 3,5X30MM NEGRO	x12
	CÓD. 74929
J - PARAFUSO 3,5X12MM FLANGEADO 3,5X12MM WASHER HEAD SCREW TORNILLO 3,5X12MM FLANGEADO	x64
	CÓD. 75655
K - PAR CORREDIÇA PAIR OF SLIDES PAR DE RIELES	x08
	350MM CÓD. 86454
L - PREGO 10X10 10X10 NAIL CLAVO 10X10	x130
	23MM CÓD. 77966
M - FIXADOR P/ COSTA DE ROUPEIRO FIXER FOR BACK WARDROBE FIJADOR PARA ESPALDAR	x36
	CÓD. 78104
N - CABIDEIRO COAT HANGER PERCHERO	x01
	ALUMÍNIO CÓD. 72850
O - CANTONEIRA PLÁSTICA PLASTIC CORNER PLATE ESQUINERO PLÁSTICO	x17
	CÓD. 77570
P- PARAFUSO 3,5X35MM 3,5X35MM SCREW TORNILLO 3,5X35MM	x16
	CÓD. 74933
Q - SUPORTE DE PRATELEIRA SHELF SUPPORT SOPORTE PARA ESTANTE	x08
	CÓD. 75783
R - PINO PARAFUSO BRONZE. SCREW SUPPORT BRONZE SOPORTE DE TORNILLO BRONZE.	x12
	CÓD. 75780
S - PARAFUSO 3,5X16MM . 3,5X16MM SCREW . TORNILLO 3,5X16MM.	x12
	CÓD. 74277
T - ADESIVO LOGO LOPAS LOPAS LOGO ADHESIVE ADHESIVO LOGOTIPO LOPAS	x01
	CÓD. 84359
U - PARAFUSO 3,5X20MM 3,5X20MM SCREW TORNILLO 3,5X20MM	x02
	CÓD. 74285
V - SUPORTE CABIDERO CENTRAL CENTER COAT HANGER SUPPORT SOPORTE PARA PERCHERO CENTRAL	x01
	CÓD. 75786

TERMO DE GARANTIA

DISPOSIÇÕES E PRAZOS DE GARANTIA

A Móveis LOPAS estipula que o produto especificado terá garantia legal de 90 (noventa) dias, à partir da data de emissão da nota fiscal, contra defeitos de fabricação nos termos do artigo 26, II do CDC. Quaisquer garantias adicionais fornecidas pelo lojista são de responsabilidade exclusiva destes, sendo, portanto os únicos responsáveis em caso de defeito do produto após a garantia legal, concedida pela fabricante.
A Móveis LOPAS não possui pontos de assistência técnica.
Constatado o eventual defeito de fabricação, desde que, dentro do prazo de garantia legal, o consumidor deverá entrar em contato com a loja onde adquiriu o produto.
No prazo de garantia, as partes eventualmente defeituosas serão substituídas gratuitamente, por outra da mesma linha e modelo.
O projeto, instalação e a montagem na residência do consumidor não serão de responsabilidade da Móveis LOPAS.
A montagem deve seguir corretamente as instruções dos manuais que se encontram dentro da embalagem de cada módulo.
Esta garantia é válida em todo território brasileiro.

EXCLUSÃO DA GARANTIA

O presente termo exclui de sua garantia:
Danos causados em conseqüências de acidentes, mau uso, manuseio ou deslocamento incorreto dos produtos;
Avarias ou defeitos causados por montagem inadequada;
Danos em decorrência de agentes externos (inundações, incêndios, etc);
Danos causados pela utilização do produto em ambientes sujeitos a gases corrosivos, umidade excessiva, mofo, acondicionamento em locais de altas/baixas temperaturas, poeira ou acidez.
Danos causados por infestação de cupins e outras pragas;
Defeitos por exposição a luz solar excessiva;
Desgaste natural devido ao uso do produto;

CUIDE BEM DO SEU MÓVEL

Dicas de limpeza e conservação:

- Para limpar corretamente seu produto, use sempre um pano liso e levemente umedecido com água;
- Não se esqueça de enxugar o seu móvel! Ele não deve permanecer úmido, pois a água pode prejudicar o acabamento ou causar mofo na madeira;
- Não se recomenda o uso de produtos à base de amoníaco.
- Não utilize esponja de aço ou qualquer material que possa arranhar a superfície do produto durante a limpeza;
- Não utilize plásticos ou papéis coloridos para forrar seu móvel.
- Evite arrastar objetos em cima do móvel. Eles podem riscar e prejudicar o acabamento do seu móvel.
- O material dos seus móveis tem um tratamento contra fungos e cupins, mesmo assim, em ambientes infestados recomenda-se a dedetização antes de instalar o seu móvel.
- Tente evitar a exposição direta ao sol. Sugere-se utilização de cortinas para proteger seu móvel;

A Móveis LOPAS reserva-se o direito de alterar quaisquer características técnicas ou estéticas e introduzir melhoramentos nos produtos comercializados a qualquer momento, sem obrigação de efetuar o mesmo nos produtos em estoque ou já comercializados (vendidos).

TAKING GOOD CARE OF YOUR FURNITURE

Cleaning and caring instructions:

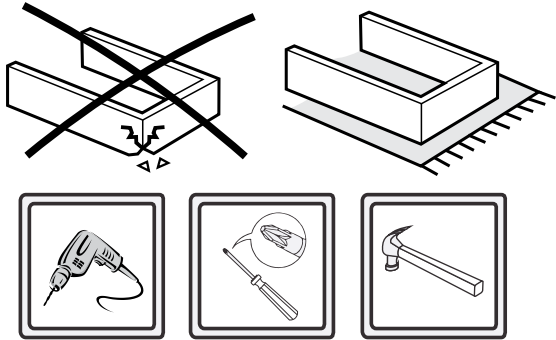
- Wipe the wood furniture down with a moist cloth to properly clean the furniture.
- Do not forget to dry your furniture out. Humidity can damage the finish or create mould.
- Chemical products are not recommended;
- Never clean the furniture with scouring powders, steel scrubber pads or any other product which can scratch its

- Furniture surfaces should not be covered with colored plastic or paper sheets.
- Avoid dragging objects on top of the furniture. They might scratch the finishing.
- Wood furniture are made of mould and termites resistant materials, however, it is recommended to use termiticides in infested places before installing the furniture.
- Avoid furniture exposure to direct Sun light. Drapers suggested.

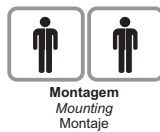
CUIDE BIEN DE SU MUEBLE

Indicaciones de limpieza y conservación

- Para limpiar correctamente su muebles de madera, siempre use un paño húmedo.
- No se olvide de secar su muebles! No debe permanecer húmedo, pues el agua puede perjudicar el acabado o causar moho en la madera.
- No es recomendable utilizar productos con amoníaco.
- No utilizar esponjas de acero o cualquier material que dañe la superficie de los muebles.
- No utilizar plásticos o papeles coloridos para forrar los muebles.
- Evite arrastrar objetos encima de los muebles. Ellos pueden riscar o dañar el acabado de su mueble.
- El material de los muebles tiene un tratamiento contra los hongos y las polillas, aun así, en ambientes infectados, se recomienda desinfectar antes de instalar su mueble.
- Evite la exposición directa al sol. Se sugiere la utilización de cortinas para proteger sus muebles.



As ferramentas necessárias para montagem do produto não são fornecidas.
The necessary tools for assembly aren't supplied.
Las herramientas necesarias para armar los productos no son fornecidas.



Sugestão da quantidade de pessoas necessárias para montagem.
Tip of the number of people required for product assembly.
Consejo de la cantidad de personas necesarias para el armado de productos.



Tempo de montagem
Assembly time
Tempo de armado

120min.

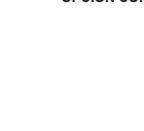
01

Diagram illustrating the assembly of the base plate (08x) using screws (03). The screws are shown being inserted into the base plate from the bottom. A detail view shows the screw (03) passing through the base plate (08x) into the wall (G).

04 OPÇÃO SEM PÉ
WITHOUT OPTIONAL FOOT
OPCION SIN PIE

Diagram 04 illustrates the assembly of the optional foot. It shows a perspective view of a long rectangular plate (05) and a shorter plate (06) being joined by four screws (02). The screws are shown in two positions: one already inserted into the shorter plate (06) and another being inserted into the longer plate (05). A circular callout provides a close-up of a screw (02) being inserted into the longer plate (05) using a screwdriver (E+H). The callout also indicates that eight screws (x08) are required. Below the main diagram, there are two small icons: a square foot (E) and a screw (H), both labeled x08.

05 OPÇÃO COM PÉ
WITH OPTIONAL FOOT
OPCION CON PIÉ



Y+X
08x

01 02 03 04

Y X

x32 x08

06

The diagram shows a long, thin component with several segments. A circular callout labeled 'K' shows a close-up of a black pin being pushed down into a slot. A curved arrow indicates the downward motion. A second circular callout shows the pin fully seated, and a large arrow points to a third circular callout showing the pin being pushed further down, causing a small part (K1) to pop out. Below the main component, a horizontal line with segments is shown with a black arrow pointing left towards a circular callout labeled 'K1'. To the right of this line is another circular callout labeled 'K2'.

Abaixa a alça preta e retire a peça K1 conforme abaixo.

Push the black pin down to remove the K1 part.

Empujar para abajo la pieza negra para retirar la parte K1

07

Diagram illustrating the assembly step for the bridge structure. The diagram shows two side views of the bridge with callouts for parts K1+H (x06), G (x04), and 20 (x04). Below the bridge is a long bar with two upward-pointing arrows. To the right are three small diagrams: K1 (x04) showing a screw, G (x16) showing a black rectangular block, and H (x16) showing a hatched rectangular block.

Local onde será parafusado.
Local where have to be screwed.
Local donde deve ser atornillado.

09



23

x04

10

Diagram 10 illustrates the assembly of the side rails. The main structure consists of two vertical rails labeled 20 and 21, and two horizontal rails labeled 22. Four corner brackets, labeled P, are being attached to the corners of the frame. A callout provides a detailed view of a bracket P being secured to a rail with a screw (x16). The quantity x04 indicates that four such brackets are required for this step.

11

L 05x

23

x04

L 20

12

Local onde será parafusado.
Local where have to be screwed.
Local donde deve ser atornillado.

K2 + H

x04

K2 + H

x04

H

x16

K2

x04

14

Diagram 14 illustrates the step of attaching the back panel (05) to the frame (01). The back panel (05) is shown being aligned with the frame (01). A callout shows a screw (04x) being used to secure the back panel to the frame. A clip (06) is also shown being attached to the frame (01) to hold the back panel in place. A legend at the bottom left shows a screw (04x) and a clip (06).

15

Diagram 15 illustrates the final assembly step: mounting the front panel. Two side rails (04) are shown being attached to the front panel (03) using screws (08x). An inset shows the front panel (03) being inserted into the main unit frame.

17

L
04x

08

x10

18

Diagram 18 shows the assembly of the bottom panel (07) to the side panel (06). A circular callout provides a detailed view of a screw (04x) being inserted into the side panel (06) to secure the bottom panel (07). The screw is labeled '04x' and the side panel is labeled '06'. The bottom panel is labeled '07'. A small inset at the bottom left shows the screw (04x) and a screwdriver.

19

Diagram 19 illustrates the assembly of the 04x component. The main view shows a rectangular frame with four corner brackets (09) and a central cylindrical component (04x) being inserted into the top. An inset shows a top-down view of the corner brackets (09) and a small component (07) being attached to the corner.

22

Diagram 22 illustrates the step of attaching the top of the cabinet. A perspective view shows the cabinet frame with a top panel being attached. A curved arrow points from a detail view to the attachment point. The detail view shows a panel with a 14mm hole being secured with a 12mm screw. The main view has labels 14 and 14 pointing to the top panel and the side panel respectively.

23

Diagram showing the assembly of a mechanical component (15) with various fasteners and sub-assemblies:

- G** (x04): A bolt used to secure the component.
- J + O** (x03): A sub-assembly consisting of a bracket (J) and a pin (O).
- J** (x12): A spring component.

24

AA  x10

F  x04

15

10x

FACE INTERNA
INNER FACE
CARA INTERIOR

F

04x

[illegible]

26

Diagram of the 18x17x17 cm display case. The diagram shows the case with dimensions 18, 17, and 17. Callouts indicate the required hardware:

- M + L**: Screws for the top and bottom rails (12X).
- L**: Screws for the side rails (21).
- M**: Screws for the base (12).

500X200X03

158,5mm

45mm

45mm

45mm

45mm

25

W1

x02

900X235X03

27,5mm

27,5mm

488,5mm

488,5mm

25

W2

x02

montagem do espelho (opcional).
Assembly mirror (optional).
armado del espejo (opcional).

S+R

W1

06x


S+R

W2

02x

W1	x06
W2	x02
R	x12
S	x12

32 Opção sem espelho.
Option without mirror.
Opção sin espejo.

An isometric line drawing of a tall, narrow wardrobe. It features three vertical doors, each with a simple rectangular handle. At the bottom of the unit, there are two horizontal drawers. The drawing is minimalist, using only black lines on a white background.

Opção com espelho.
Mirror option.
Opción con espejo.